



JX Truck Center - Madison  
 4205 Anderson Road  
 DeForest, WI 53532  
 Phone: 608-241-4101  
 (Division of Peterbilt of Wisconsin, Inc.)

**\*\*\* Customer Review \*\*\***

Date / Time: 8/5/2022 5:23:42PM  
 Repair Order: 39332  
 Customer: 00160  
 Branch: MADSN  
 Invoice Total: \$ 2,246.50

\*\*\*COD\*\*\*  
 Page 1 of 5

**Bill To:** Mcon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

**Ship To:** Mcon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

Customer P/O: jbrat Completion Date:

**Unit Number: 460677**                      **Model Year: 2018**                      **Make/Model: PETERBILT 389**  
**Type: Heavy Duty Truck**                      **VIN: 1XPXD9X5JD460677**                      **Meter: 554475 Miles**  
**ECM Reading: 13698**

DO NOT BILL SERVICE GATE INVOICES TO THIS ACCOUNT EVER

**Task: 1      1062                      Diag-Advanced                      Department: Service**

**Complaint:** Has a MIL light on they say it an ambient temp sensor check and advise  
 POC is Chris 608-287-4545 or Matt at 608-341-7433

See attached access SRT Checklist  
 Advanced diag

**Correction:** 8/5/2022 9:02:57 AM 1181 8 5 22  
 BROUGHT TRUCK INTO SHOP AND FOUND CODES ARE  
 P0073 INACTIVE --  
 P1298 INACTIVE 8  
 3861 INACTIVE 1  
 P3929 INACTIVE 1  
 P3973 INACTIVE --  
 FOUND SOFTWARE WAS UP TO DATE  
 CLEARED CODES AND RT FOUND NO FAULTS CAME BACK BUT  
 THE ENGINE FAN WAS ON ALMOST ALL THE TIME  
 THERE WAS A COOLANT LEAK.1181  
 8/5/2022 5:15:06 PM 1181 8 5 22  
 LOOKED OVER THE TRUCK AS PER CUSTOMER  
 ALSO RAN A OUTLET NOX EVALUATION TEST THREE TIMES AND FAILED EVERY TIME  
 RR THE OUTLET NOX AS PER CUSTOMER  
 BACKED TRUCK OUTSIDE AND RAN REGEN  
 FOUND THERE IS WHITE SMOKE COMING FROM THE EX AND DONT KNOW IF THIS IS COOLANT BURNING OFF FROM A  
 PREVOIUS FAULURE  
 WENT THRU COMPLETE REGEN AND TOOK FOR RT  
 FOUND THE OILTEMP WAS RUNNING ABOUT 230 WERE IS SHOULD BE 30 DEGREE HOTTER THAN THE COOLANT TEMP  
 ALSO VERIFIED THE ENGINE FAN OPERATION AND WORKS WITH AC AND TURNS ON WITH SWITCH  
 OPERATION ALL OK.1181

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Extende Pric
008	TECHNOLOGY FEE	Misc	1.00	50.00	50.00
901	Shop Supplies	Misc	1.00	44.69	44.69
1954664PRX	SENSOR-NOX	Part	EA 1.00	718.19	718.19
1954664PRX-C	432687200 D - SENSOR-NOX OP	Inherent	1.00	266.75	266.75
1954664PRX-C	432687200 D - SENSOR-NOX OP	Part	EA (1.00)	266.75	(266.75)



JX Truck Center - Madison  
 4205 Anderson Road  
 DeForest, WI 53532  
 Phone: 608-241-4101  
 (Division of Peterbilt of Wisconsin, Inc.)

**\*\*\* Customer Review \*\*\***  
 Date / Time: 8/5/2022 5:23:42PM  
 Repair Order: 39332  
 Customer: 00160  
 Branch: MADSN  
 Invoice Total: \$ 2,246.50  
 \*\*\*COD\*\*\*  
 Page 2 of 5

**Bill To:** Mcon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

**Ship To:** Mcon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

Customer P/O: jbrat Completion Date:

**Task Subtotals**

Parts:	\$718.19
Core Chg:	\$266.75
Core Ret:	(\$266.75)
EHC:	\$0.00
Labor:	\$470.42
Miscellaneous:	\$94.69
Hours: 2.43	
<b>Task 1 Subtotals:</b>	<b>\$1,283.30</b>

**Task: 2 042011001 Water / Coolant / Block Heater Department: Service**

**Complaint:** THERE WAS A COOLANT LEAK

**Correction:** 8/5/2022 10:49:12 AM 1181 8 5 22  
 CHECKED OVER THE TRUCK FOR COOLANT LEAKS  
 FOUND THE BOTTOM OF THE OIL COOLER FILTER HOUSING IS LEAKING COOLANT,  
 DON'T KNOW IF THE LEAK IS COMING FROM THE PLUG OT THE O-RINGS TO BLOCK TOOK PIC AND SENT ON E-MAIL  
 ALSO FOUND RIGHT SIDE FUEL TANK STRAPS ARE LOOSE  
 THE LEFT STACK GAIRD IS HITTING THE SLEEPER AND RUBBING INTO FIBERGLASS  
 TOOK PIS OF ALL SENT IN E-MAIL.1181

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Extende Price
901	Shop Supplies	Misc	1.00	5.85	5.85

**Task Subtotals**

Parts:	\$0.00
Core Chg:	\$0.00
Core Ret:	\$0.00
EHC:	\$0.00
Labor:	\$61.60
Miscellaneous:	\$5.85
Hours: 0.35	
<b>Task 2 Subtotals:</b>	<b>\$67.45</b>

**Task: 3 042003024 FAN CLUTCH SOLENOID Department: Service**

**Complaint:** engine fan stays on all the time

**Correction:** 8/5/2022 11:29:38 AM 1181 8 5 22  
 VERIFIED THE COMPLAIT OF THE ENGINE FAN ON ALL THE TIME  
 MADE A MONITORING SET UP TO SEE WHAT IS TURNING ON THE FAN  
 FOUND THE AC IS TURNING ON THE FAN AND RR THE FAN SENDER FOR THE AC  
 FOUND FAN DOESN'T RUN CONSTANT AND WILL NEED TO RT AND SEE IF FAN STAYS OFF  
 1181

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Extende Price
901	Shop Supplies	Misc	1.00	11.20	11.20



JX Truck Center - Madison  
 4205 Anderson Road  
 DeForest, WI 53532  
 Phone: 608-241-4101  
 (Division of Peterbilt of Wisconsin, Inc.)

**\*\*\* Customer Review \*\*\***

Date / Time: 8/5/2022 5:23:42PM  
 Repair Order: 39332  
 Customer: 00160  
 Branch: MADSN  
 Invoice Total: \$ 2,246.50

\*\*\*COD\*\*\*  
 Page 3 of 5

**Bill To:** Mcon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

**Ship To:** Mcon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

Customer P/O:	jbrat	Completion Date:			
79PSL3-4	SWITCH-R134A-HSFO (FanOverride)	Part	EA	1.00	60.47 60.47

**Task Subtotals**

Parts:	\$60.47
Core Chg:	\$0.00
Core Ret:	\$0.00
EHC:	\$0.00
Labor:	\$117.91
Miscellaneous:	\$11.20
<b>Task 3 Subtotals:</b>	<b>\$189.58</b>

**Task: 4 044001019 FUEL TANK STRAP**

**Department: Service**

**Complaint:** tanks straps are loose try to tighten up

**Correction:** 8/5/2022 3:32:12 PM 1181 8 5 22  
 FOUND BOTH TANK STRAPS ON THE RIGHT SIDE LOOSE  
 HAS TO HEAT THE NUTS TO GET THEM OFF AND INSTALLED NEW NUTS AND TORQUEWD.1181

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Extende Pric
901	Shop Supplies	Misc	1.00	4.51	4.51
HWC12501	NUT-HEX SL NYL M16-2.00X18.5	Part	2.00	2.77	5.54

**Task Subtotals**

Parts:	\$5.54
Core Chg:	\$0.00
Core Ret:	\$0.00
EHC:	\$0.00
Labor:	\$47.52
Miscellaneous:	\$4.51
<b>Task 4 Subtotals:</b>	<b>\$57.57</b>

**Task: 5 043003042 EXHAUST HEAT SHIELD**

**Department: Service**

**Complaint:** reposition the exhaust heat shield

**Correction:** 8/5/2022 3:16:37 PM 1181 8 5 22  
 VERIFIED THE COMPLAINT  
 REMOVED THE HEAT SHEILD FOUND THE BUSHING ARE ALL WORN OUT ON THE TOP ALSO  
 REPLACED ALL BUSHING AND THEN HAD TO HEAT THE NUTS TO LOOSE THE UPPER CLAMP  
 ALSO CUT THE LOWER CLAMP AND TURNED THE CENTER EX PIPE TO BE AWAY FROM THE BUNK  
 DRILLED HOLE IN LOWER PIPE AND INSTALLED RIVET TO KEEP FROM TURNING  
 INSTALLED NEW LOWER CLAMP AND TIGHTENED THE UPPER CLAMP  
 INSTALLED HEAT SHEILD HAD TO CHANGE ON SUPPORT BRACK FOR EVERYTHING TO WORK AND NOW IS AWAY FROM THE  
 BUNK AREA.1181

Supp. Part	Description / Ref Number	U/M	Quantity	Price	Extende Pric
------------	--------------------------	-----	----------	-------	--------------



JX Truck Center - Madison  
 4205 Anderson Road  
 DeForest, WI 53532  
 Phone: 608-241-4101  
 (Division of Peterbilt of Wisconsin, Inc.)

**\*\*\* Customer Review \*\*\***

Date / Time: 8/5/2022 5:23:42PM  
 Repair Order: 39332  
 Customer: 00160  
 Branch: MADSN  
 Invoice Total: \$ 2,246.50

\*\*\*COD\*\*\*  
 Page 4 of 5

**Bill To:** Mccon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

**Ship To:** Mccon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

Customer P/O:						Completion Date:		
901		Shop Supplies	Misc			1.00	39.79	39.79
M13-6004		BUSHING-PIN, ISOLATOR	Part	EA	2.00		9.49	18.98
M13-1009		BUSHING-MOUNTING EXHAUST	Part	EA	1.00		30.02	30.02
JX50PLS		CLAMP-EXHAUST WB PREFRMD 5" (EC50PLS)	Part	EA	1.00		12.95	12.95
M11-6439		BRACKET-AERO GUARD OUTER	Part	EA	1.00		9.73	9.73
HWU10797		WASHER-ROUND SAE 5/16 SS	Part	EA	1.00		0.27	0.27
MP47324		SS A2 HX HD CS M8X1.25X25MM	Part	EA	1.00		0.88	0.88

**Task Subtotals**

	Parts:	\$72.83
	Core Chg:	\$0.00
	Core Ret:	\$0.00
	EHC:	\$0.00
Hours: 2.38	Labor:	\$418.86
	Miscellaneous:	\$39.79
	<b>Task 5 Subtotals:</b>	<b>\$531.48</b>



JX Truck Center - Madison  
 4205 Anderson Road  
 DeForest, WI 53532  
 Phone: 608-241-4101  
 (Division of Peterbilt of Wisconsin, Inc.)

**\*\*\* Customer Review \*\*\***  
 Date / Time: 8/5/2022 5:23:42PM  
 Repair Order: 39332  
 Customer: 00160  
 Branch: MADSN  
 Invoice Total: \$ 2,246.50  
 \*\*\*COD\*\*\*  
 Page 5 of 5

**Bill To:** Mccon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

**Ship To:** Mccon Building Corporation  
 1059 Circle Dr  
 Highland, WI 53543

Customer P/O: jbrat

Completion Date:

Payment Method  
 COD

Totals	
Total Parts:	\$857.03
Total Core Chg:	\$266.75
Total Core Ret:	(\$266.75)
Total EHC:	\$0.00
Total Labor:	\$1,116.31
Total Miscellaneous:	\$156.04
Invoice Subtotal:	\$2,129.38
Total Tax:	\$117.12
Invoiced Total:	\$2,246.50

ANY COMPLAINT REGARDING WORKMANSHIP CONCERNING REPAIRS PERFORMED BY THE DEALERSHIP MUST BE BROUGHT TO THE ATTENTION OF THIS DEALERSHIP WITHIN 30 DAYS OF RECEIPT OF THE VEHICLE BY THE CUSTOMER FOLLOWING A REPAIR OR IT WILL BE DEEMED WAIVED FOR ALL PURPOSES. THIS LANGUAGE SHALL NOT CONSTITUTE A WARRANTY FOR ANY PURPOSE. PARTS RETURNED FOR CREDIT MUST BE ACCOMPANIED BY THIS INVOICE AND MAY BE SUBJECT TO A MINIMUM RETURN CHARGE OF 10% OF THE PURCHASE PRICE. SPECIAL ORDER PARTS MAY ALSO BE SUBJECT TO A NON-REFUNDABLE DEPOSIT. SPECIAL ORDER ELECTRICAL PARTS ARE NOT RETURNABLE. CORES MUST BE RETURNED WITHIN 30 DAYS. ALL ACCOUNTS ARE DUE AND PAYABLE WITHIN TERMS. A FINANCE CHARGE OF 1.5% (18% PER ANNUM) WILL BE CHARGED ON ALL PAST DUE ACCOUNTS. A \$25 FEE WILL BE CHARGED FOR ALL RETURNED CHECKS.

Signature: \_\_\_\_\_

Under section 405(b) of the Internal Revenue Code, you may be liable for a 12% tax on the total charge invoiced here if you purchased this vehicle new within the 6 months.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability in parts shipments by the supplier or the transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs therein. Seller not responsible for alternate transportation due to the above.

The only warranties applying to this part(s) are those which may be offered by the manufacturer. The seller dealer hereby expressly disclaims all warranties either express or implied including any implied warranties of merchantability or fitness for a particular purpose and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this part(s) and/or service. Buyer shall not be entitled to recover from the selling dealer any consequential damages, damages to property, damager for loss of use, loss of time, loss of profit or income or any other incidental damages.